

MEMS Capacitive Accelerometer

ASC 5521MF | ASC 5525MF

Triaxia

MEMS Capacitive

Measurement Range: ±2 to ±200 g Noise Density: 10 to 680 µg/√Hz Frequency Range (±5 %): DC to 1500 Hz Aluminum or Stainless-Steel Housing

Made in Germany



MEMS Capacitive Accelerometer

The key components in capacitive accelerometers are high-quality micro-electromechanical systems (MEMS) that feature excellent long-term stability and reliability. This technology enables the measurement of static (DC) and constant accelerations, which can be used to calculate the velocity and displacement of moving objects. Depending on the design of the spring-mass-damping system, however, it is also possible to detect dynamic (AC) accelerations with amplitudes up to ± 200 g and within a frequency response range of up to 1.5 kHz (± 5 %) or 7 kHz (± 3 dB). Other advantages of capacitive accelerometers are their outstanding temperature stability, excellent response behavior and achievable resolution.

Description

The accelerometers of type ASC 5521MF and ASC 5525MF are based on proven MEMS technology and capacitive operating principle. The integrated electronic circuitry enables a differential analog voltage output (± 2.7 V FSO) and flexible power supply voltage from 5 to 40 VDC. The MF (Medium Frequency) accelerometers from ASC provide a wide frequency response range from 0 Hz to 7 kHz (± 3 dB) and an extremely robust design with shock resistance up to 6,000 g.

The sensor ASC 5521MF features a lightweight aluminum housing and the sensor ASC 5525MF provides a robust stainless-steel housing, both with protection class IP67 and an integrated cable with configurable length and connectors.

The triaxial accelerometers enable the detection of smallest accelerations over a wide frequency response range in three degrees of freedom, e.g. for test bench applications, vehicle and road monitoring as well as resonance and flutter tests in aviation.

Features


- Low Noise Differential Voltage Output
 - DC Response, Gas damped
- Very High Shock Resistance
- Excellent Offset and Scale Factor Stability

Options

- Customized Cable Length
- Customized Connector
- TEDS Module

Applications

- NVH and Operational Stability
- Driving and Ride Comfort Tests
- Vehicle and Running Dynamics

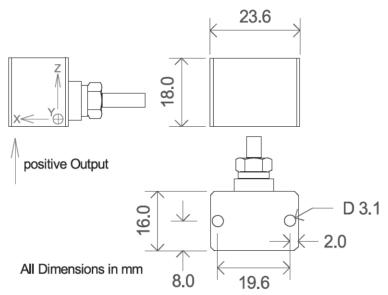





Typical Specification

I Y	٧m	2	mi	
$\mathbf{\nu}$	V I I	ıaı	ш	ıv

Measurement Range	g	±2	±5	±10	±30	±50	±100	±200
Scale Factor (sensitivity)	mV/g	1350	540	270	90	54	27	13.5
Noise Density	µg/√Hz	10	20	35	100	170	340	680
Min. Frequency Response Range (±5 %)	Hz	0 to 100	0 to 700	0 to 1000	0 to 1500	0 to 1500	0 to 1500	0 to 1500
Max. Frequency Response Range (±3 dB)	Hz	0 to 1150	0 to 1900	0 to 3200	0 to 4000	0 to 4500	0 to 5000	0 to 7000
Amplitude Non-Linearity	% FS0			<0.1	(typ) <0.3	(max)		
Transverse Sensitivity	%				<1			

Electrical

Power Supply Voltage	V				5 to 40			
Operating Current Consumption	mA				<15			
Offset (bias)	mV				±10			
Broadband Noise (over frequency range ±5 %)	μV	250	310	410	440	475	490	460
Resistive Load	kΩ				1000			
Isolation		Integrated electronic circuitry is isolated from the sensor housing Sens housing and cable shielding are internally connected						g Sensor

Environmental

Temperature Coefficient of the Scale Factor	ppm/K	120 (typ) 20 to 220 (max)						
Temperature Coefficient of the Offset (max)	mg/K	±0.2	±0.5	±1	±3	±5	±10	±20
Operating Temperature Range	°C				-40 to +100)		
Storage Temperature Range	°C				-40 to +100)		
Shock Limit (0.1 ms, half-sine)	g				6000			
Protection Class					IP67			

Physical

Sensing Element		MEMS Capacitive
Case Material		ASC 5521MF: Anodized Aluminum ASC 5525MF: Stainless-Steel
Connector at Cable End		Optional
Mounting		Adhesive Screw Holes
Weight (without cable)	gram	ASC 5521MF: 22 ASC 5525MF: 42
Cable		30 gram per meter AWG 30 Polyurethane (PUR) Diameter 4.5 mm







Sensor Calibration

Factory Calibration (supplied with the sensor)

Part Number		#14550	#18475	#14552	#14553	#14556	#14556	#14556
Measurement Range (sensor)	g	±2	±5	±10	±30	±50	±100	±200
Applied Frequency (min)	Hz	1	10	10	10	10	10	10
Applied Frequency (max)	Hz	100	700	1400	1600	1800	1800	1800
Input Amplitude	m/s²	5	15	50	100	200	200	200
Reference Frequency for Determination of Scale Factor	Hz	16	80	80	80	80	80	80

Calibration according DIN ISO 17025 (order separately)

Part Number		#14558	#18479	#14560	#14561	#14564	#14564	#14564
Measurement Range (sensor)	g	±2	±5	±10	±30	±50	±100	±200
Applied Frequency (min)	Hz	0.5	10	10	10	10	10	10
Applied Frequency (max)	Hz	150	1200	2000	2300	2500	2500	2500
Input Amplitude	m/s²	5	15	50	100	200	200	200
Reference Frequency for Determination of Scale Factor	Hz	16	80	80	80	80	80	80

Remarks:

- The conversion factor 1 g corresponds to 9.80665 m/s².
- If any other calibration procedure is required, don't hesitate to contact us. Our services include both factory calibration and calibration in accordance with DAkkS guidelines.
- Furthermore, sensors have to be calibrated regularly to ensure accurate and precise results. On request we will be glad to remind you of the next scheduled calibration of your sensors.

Cable Code / Pin Configuration (12 Wire System) including separate Power Supply for all Axes

	Pin	Color Code		Description
1	Supply +	Red/Violet	X-Axis:	power supply voltage +5 to +40 VDC
2	Supply -	Black/Violet	X-Axis:	power GND
3	Signal +	Green/Violet	X-Axis:	positive, analog output voltage signal for differential mode
4	Signal -	White/Violet	X-Axis:	negative, analog output voltage signal for differential mode
5	Supply +	Red/Grey	Y-Axis	power supply voltage +5 to +40 VDC
6	Supply -	Black/Grey	Y-Axis	power GND
7	Signal +	Green/Grey	Y-Axis:	positive, analog output voltage signal for differential mode
8	Signal -	White/Grey	Y-Axis:	negative, analog output voltage signal for differential mode
9	Supply +	Red	Z-Axis:	power supply voltage +5 to +40 VDC
10	Supply -	Black	Z-Axis:	power GND
11	Signal +	Green	Z-Axis:	positive, analog output voltage signal for differential mode
12	Signal -	White	Z-Axis:	negative, analog output voltage signal for differential mode
	Cable shielding is	provided as a tinned-copp	per braiding w	hich is also internally connected to the sensor housing





Cable Code / Pin Configuration (8 Wire System) including common Power Supply for all Axes

	Pin	Color Code		Description
1	Supply +	Red	Power:	supply voltage +5 to +40 VDC
2	Supply -	Black	Power:	GND
3	Signal +	Green/Violet	X-Axis:	positive, analog output voltage signal for differential mode
4	Signal -	White/Violet	X-Axis:	negative, analog output voltage signal for differential mode
5	Signal +	Green/Grey	Y-Axis:	positive, analog output voltage signal for differential mode
6	Signal -	White/Grey	Y-Axis:	negative, analog output voltage signal for differential mode
7	Signal +	Green	Z-Axis:	positive, analog output voltage signal for differential mode
8	Signal -	White	Z-Axis:	negative, analog output voltage signal for differential mode
	Cable shielding is	provided as a tinned-copp	er braiding w	rhich is also internally connected to the sensor housing

Cable Configuration


8 Wire System - 8L

Common power supply for all axes, no cable switch



8 Wire System - 8L3

Common power supply for all axes, including cable switch

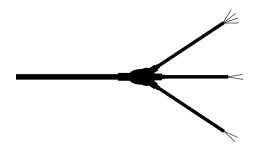


12 Wire System - 12L

Separate power supply for all axes, no cable switch



12 Wire System - 12L3

Separate power supply for all axes, including cable switch

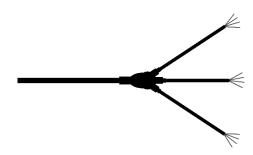

Ordering Information

Ordering information are based on standard configurations. The integrated cable features a length of 6 meters and has no connector at the cable end which is identified by "A" in the product match code. However different lengths and the assembling of almost all connector types is possible on request.

Series	Model	- Range [g]	- Cable Length [m]	Connector & Pinout	- Cable Configuration
ASC 55	21MF (Aluminum)	002	6	А	8L
	25MF (Stainless-Steel)	005			8L3
		010			12L
		030			12L3
		050			
		100			
		200			

Example:

ASC 5521MF-002-6A-8L

Remark: All customized versions regarding cable length, connector and/or pinout will lead to a corresponding product match code.

MEMS Capacitive Accelerometer



Safety Precaution for Installing and Operating

This data sheet is a part of the product. Read the data sheet carefully before using the product and keep it available for future operation. Handling, electrical connections, mounting or any other work performed at the sensor must be carried out by authorized experts only. Appropriate safety precautions must be taken to exclude any risk of personal injury and damage to operating equipment as a result of a sensor malfunction.

Handling

The sensor is packaged in a reliable housing to protect the sensing elements and integrated electronic components from the ambient environment. However, poor handling of the product can lead to damages that may not be visible and cause electrical failure or reliability issues. Handle the component with caution:

- Avoid shocks and impacts on the housing, such as dropping the sensor on hard surface
- Never move the sensor by pulling the cable
- Make sure that the sensor is used within the specified environmental conditions
- Transport and store the sensor in its original or similar packaging
- The sensor should be mounted on a stable flat surface with all screws tightened or other mounting options
- When adhesives are used to mount the sensors, please select the corresponding products according to permanent or removable mounting, ambient temperature range as well as quality of the mounting surface
- Avoid any deformation during mounting the sensor
- Mounting tolerances may have an influence on the measured result

Electrical

ASC's inertial sensors are working with many established data acquisition systems. However, make sure that a proper DAQ is used, for the corresponding operation principle of the sensor. Furthermore, suitable precautions shall be employed during all phases of shipment, handling and operating:

- Active sensor pins are susceptible to damage due to electrostatic discharge (ESD)
- Make sure that the sensor is used within the specified electrical conditions
- Check all electrical connections prior to initial setup of the sensor
- An incorrect wiring of the signal or power supply connections will lead to damages of the sensor
- Completely shield the sensor and connecting cable according to your application
- Do not perform any electrical modifications at the sensor
- Do not perform any adaptions on the wiring or connectors while the device under power
- Never plug or unplug the electrical connection while the sensor is under power
- When a certain pin is not used during operation, make sure that the pin is insulated

Quality

- We have a quality management system according to ISO 9001:2015.
- The Deutsche Akkreditierungsstelle GmbH (DAkkS) has awarded to our calibration laboratory the **DIN EN ISO/IEC 17025:2018** accreditation for calibrations and has confirmed our competence to perform calibrations in the field of mechanical acceleration measurements. The registration number of the certificate is **D-K-18110-01-00**.
- The sensors described in the data sheet are CE-compliant.





Specifications are subject to change without notice. All data, information, statements, photographs and graphic illustrations made in this data sheet are without any obligation and raise no liabilities to or form part of any sales contracts of ASC GmbH or any affiliates for components referred to herein. ® ASC GmbH 2021. All rights reserved. No part of this copyrighted work may be reproduced, modified or distributed in any form or by any means, or stored in any database or retrieval system, without the prior written permission of ASC GmbH or its affiliates. Any such unauthorized use for any purpose is a violation of the relevant copyright laws.

Revision: 22nd December 2023

